


# HDL-DDLS-4

## DRAWING (mm)



## PHOTO

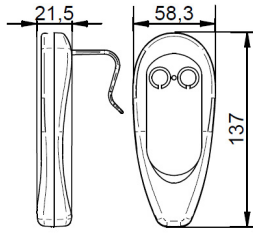

## MODEL NO. DESIGNATION



Example: HDL-DDLA-1


## OPTIONAL CONTROL BOX AVAILABLE



GENERAL DATA	
Product name	HDL-DDLS-4
Mode	Synchronous
Number of actuators	4
Compatible control box	DDLS-4
Cable length mm	880   spiral 420
Permissible ambient temperature deg. C	+5°C ~ +40°C
IP	IP20
Connector handset	10P10C (RJ50) Plug
Body material/s	ABS
Color	Pantone cool gray 11C   black   black spiral cable and connector
Color	Black

## CONNECTOR PIN LAYOUT

10P10C (RJ50) Jack



## OPERATION GUIDENCE SYNCHRONOUS CONTROL BOXES

- Connect all actuators adapter cables between the control box and the actuator
- All actuators must be connected to the control box for functional operation
- Press and hold down both hand control buttons 3 seconds to start automatic calibration process
- Press and continuously hold down the M button on the hand control for actuators operation
- Actuators will have a few mm stopping distance
- The actuators will stop automatically by its internal limit switches at end position

## CONNECTOR PIN CONFIGURATION

10P10C (RJ50)

1	
2	5V
3	
4	
5	1 Up M1
6	
7	
8	1 Down M1
9	
10	